PARISI

TROUBLESHOOTING

PROBLEM	CAUSE	SOLUTION
Water leaking into bowl.	Leaking outlet valve caused by debris in bottom of cistern stopping valve properly closing after flush.	Turn off stop cock. Remove outlet valve and clear debris.
	Leaking outlet valve caused by incorrectly installed or faulty seal.	Replace seal.
	Leaking Inlet valve.	Clean inlet valve.
		Replace inlet valve.
	Stop-cock or mini-tap leaking.	Tighten or replace stop-cock or mini-tap.
Water leaking onto floor.	Flush Pipe or P-trap waste connector leaking.	Remove pan and re-install pipe and connector ensuring proper sealing of pipes to ceramic outlets.
Loose seats.	Hinge pin bolts are loose.	Remove seat and tighten hinge pin bolts. (Refer seat installation guide)
Toilet seat or cover slamming closed.	Soft close hinges are faulty or damaged.	Replace soft close hinges- available as a spare part.

WARRANTY

Refer to our website for full warranty terms and conditions:

www.parisi.com.au/pages/warranty-information





PARISI









PN610 ELLISSE PN710 SLIM PN740 L'HOTEL PN770 LINFA

PN810 ELLISSE ACCESSIBLE PN830 ELLISSE AMBULANT

WALL FACED PAN INSTALLATION INSTRUCTIONS








November 2023


INSTALLATION


INSTALLATION AND TESTING TO BE UNDERTAKEN IN ACCORDANCE WITH RELEVANT PLUMBING STANDARDS. PLEASE CHECK THAT ALL PARTS ARE INCLUDED AND COMPONENTS ARE NOT DAMAGED. DO NOT INSTALL ANY DAMAGED COMPONENTS. CONTACT POINT OF PURCHASE FOR REPLACEMENT. * TOILETS HAVE REGULATORY APPROVAL TO BE INSALLED USING SILICONE ADHESIVE/BEDDING.

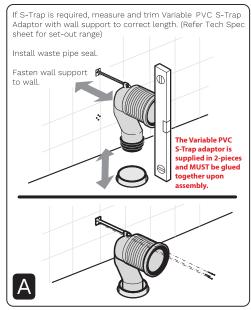


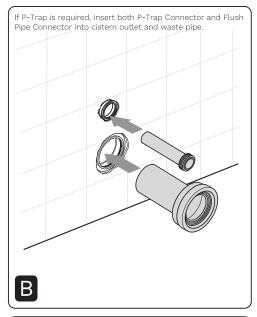


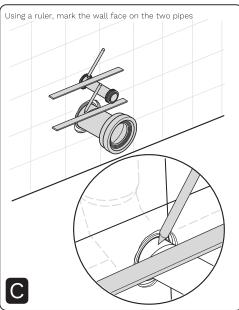


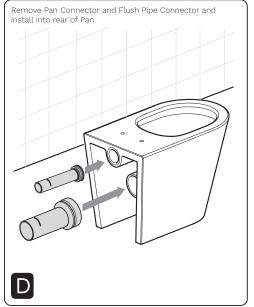

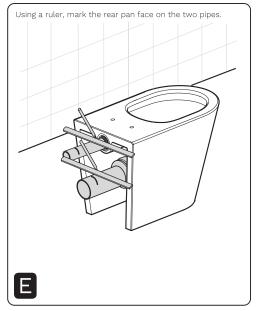

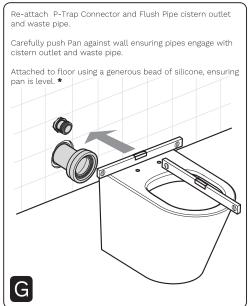

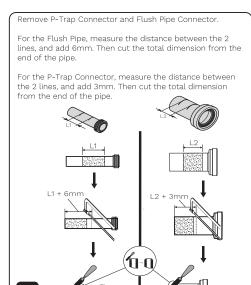

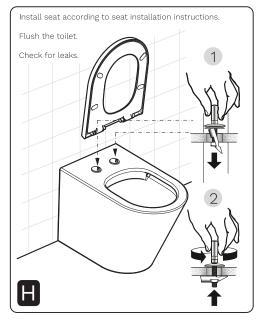

after cutting to size